


Sections 5 & 6- T10N-R01W, 2nd P.M.
Washington Township, Monroe County, Indiana

Section 06 T10N-R01W Section 05 T10N-R01W

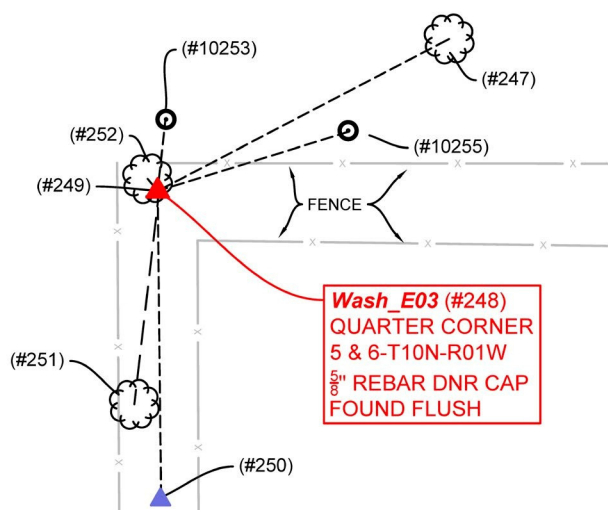

<i>ID</i>	<i>Bearing</i>	<i>Distance</i>	<i>Description</i>
(#252)	N39° 49'W	3.3'	40" diameter Sugar Maple tree.
(#247)	N62° 30'E	68.4'	Center of cluster of triple 49" diameter (at base) poplar trees.
(#251)	S06° 16'W	44.6'	20" diameter poplar tree with Monroe County witness sign attached facing #250.
(#249)	N82° 23'W	0.8'	½" diameter steel electric fence post with MCSO marker sign attached.

(#10253)	N06° 07' 24"E	14.64'	N:1487683.2721' E:3102018.3916' Rebar Lite
(#10255)	N72° 47' 48"E	41.30'	N:1487668.7156' E:3102016.8300' Rebar Lite
(#250)	S00° 38' 22"E	63.42'	N:1487605.2968' E:3102017.5377' 4" by 4" cut limestone found 1.2' above ground



MONUMENT RECORD

Corner ID: **Wash_E03**

Quarter Corner

Sections 5 & 6- T10N-R01W, 2nd P.M.
Washington Township, Monroe County, Indiana

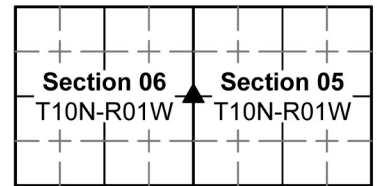


PHOTO IDENTIFIED: Photo Date: 08/07/2025



Photo Orientation & Description: From Above



Photo Orientation & Description: From East looking West

EXISTING SURVEY HISTORY Include as much detail and history of the corner as known at the time of perpetuation

ORIGINAL GOVERNMENT SURVEY:

Year Surveyed: 1819 By: Thomas Brown Deputy Surveyor.
Where filed or recorded: Monroe County Original Notes Page 140
Original monument: Post
Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Distance
Dogwood	6"	N47°W	11 links
Dogwood	5"	S23°E	18 links

Notes:

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: December 1872 By: James W Spencer Deputy
Monroe County Surveyor.

Where filed or recorded: Legal Survey Book 2, Page 209

Original monument: Stone

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Distance
Poplar	20"	N32°W	74 links
		°	

Notes:

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: April 27, 1882 By: M. H. Buskirk Monroe County
Surveyor.

Where filed or recorded: Legal Survey Book 2 Page 366

Original monument: Not noted

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Distance
Poplar	24"	N32°W	74 links
Black Walnut	15"	S6°W	212 links

SUBSEQUENT CORNER RESTORATION:

None found in Legal Survey Books.

OTHER SURVEY HISTORY: Include details such as surveyor name, date, recording info, monument description, etc.

DocumentDate	SurveyID	Surveyor	Description	InstrumentNo
	RSID004036	Graham, Raymond	50.86 acre survey	
1/23/1973	RSID005807	Graham, Raymond	Graham corner perpetuation	
2/10/1973	RSID005897	Graham, Raymond	"Wayne Fix 1.57, 16.96 and 11.52 Acre Tracts"	
1/17/1986	RSID001296	Vollmer, Robert C.	Boundary Line Survey. Morgan-Monroe State Forest	



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 2 of 4

MONUMENT RECORD

Corner ID: **Wash_E03**

Quarter Corner

Sections 5 & 6- T10N-R01W, 2nd P.M.
Washington Township, Monroe County, Indiana

Section 06

T10N-R01W

Section 05

T10N-R01W

7/8/1987	RSID005782	Vollmer, Robert C.	Department of Natural Resources, Morgan-Monroe State Forest Survey	
2/18/2005	RSID005799	Guerrettaz, Bernard	Irvine/Merriam Boundary Survey	2005004945.IN
3/3/2005	RSID005806	Guerrettaz, Bernard	Irvine-Merriam Type E administrative Subdivision	2005011738.IN
6/3/2009	RSID001297	Vollmer, Robert C.	Access survey from the Burma Road near the Buskirk Junction for Forestry Operations.	
2/5/2013	RSID005900	Guerrettaz, Bernard	"Irvine-Merriam Type "A" Administrative Subdivision"	2013002631.IN

ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND BY THE MONROE COUNTY SURVEYORS OFFICE: *Include, search area or areas, search procedure, etc.*

Date of Field work/Search: 07/13/2009 *By:* Kevin Enright, Jason Mintl, Bob Vollmer & Frank Ballantyne. *Monument Found:* Rebar Set *BTs or Reference Objects Found:* References established. *Project #*Washington E03 *Field Book:* 42 page 73. *Notes:* This appears to be when the rebar was set and the first time the cut limestone that had been tied off on a prior Monroe County Surveyors Office tie card by Ben Bledsoe was not accepted by this office.

ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND BY THE MONROE COUNTY SURVEYORS OFFICE: *Include, search area or areas, search procedure, etc.*

Date of Field work/Search: 07/18/2025 & 07/23/2025 *By:* MES/JMG/EGC *Monument Found:* Capped Rebar *BTs or Reference Objects Found:* From prior MCSO project. *Project #*25-003 *Field Book:* 58 Pages 70, 71 & 73 *Notes:*

OTHER EVIDENCE: *Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.*

The Rebar is in a deep cut old, abandoned Roadbed, at the Northwest corner of where the old roadbed turns South and East. We reached the site by walking approximately 400 feet North from the intersection of Burma and Buskirk Roads.

MONUMENT PRESERVATION: *Describe work done to preserve existing monument.*

GPS coordinates were established on the Rebar. 2 rebar lites were set and a cut limestone found and located within sight of it, that could be used to reestablish its location, should it become obliterated. We also located trees, for visual reference. A steel post with Monroe County Survey marker sign, facing West, was observed 0.8' West of the Rebar.

THEORY OF LOCATION: *Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.*

The Rebar was found. It appears to have been set by Department of Natural Resources Surveyors Robert C. Vollmer PLS and Frank F. Ballintyne PLS, with Monroe County Surveyor Kevin Enright present, in conjunction with a survey dated 05/11/2009 and documented in RSID001297 in the Monroe County Surveyors Office. In the report associated with said Survey, Mr. Vollmer and Mr. Ballintyne go into great detail about why they do not feel the cut Limestone that is $\pm 63.4'$ South of this Rebar is not in an acceptable location to be considered the originally established location of the corner and I am in agreement with their analogy. I do not read as much detail into how they chose the exact location they did to set their rebar, it appears that it was based largely on the assumption (based on old maps) that the old roadbed was built on the Section line. The rebar they set does, in my opinion appear reasonably well situated, when compared to other monuments and occupation lines in and around the Section and was therefore held and accepted as the most reliable evidence of the original location of the corner, though with an uncertainty of as much as 71' northsouth and 11' east west due to the fact that proportional measurement between the monuments at each end of the Section line based on the distance shown in Legal Survey Book 2 page 209 of 337 poles and 12 links (5568.42') would place the corner $\pm 71'$ South and $\pm 10.5'$ West. Another possible location for the corner that Mr. Vollmer appears to have used in a prior survey is extending the line and doubling the distance from the stones at Wash_C03 and Wash_D03, which would create a point $\pm 1.4'$ South and $\pm 3.6'$ West of the Rebar found.

GEODETIC COORDINATES: *Northing:* 1487668.7', *Easting:* 3102016.8'



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 3 of 4

MONUMENT RECORD

Corner ID: **Wash_E03**

Quarter Corner

Sections 5 & 6- T10N-R01W, 2nd P.M.

Washington Township, Monroe County, Indiana

Section 06

T10N-R01W

Section 05

T10N-R01W

BASIS OF GEODETIC COORDINATES:

The basis of bearings is Grid North NAD83(2011), Indiana West Zone, Epoch 2010.0000, Geoid Model G2012BU7, Datum NAD83_NO_TRANS, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Coordinate data was collected with a Javad Triumph LS Network Rover and/or with a Sokkia Set 510 Total Station radially from points located with GPS. Distances obtained with GPS have not been adjusted to ground. To adjust grid distances to ground distances multiply them by a scale factor of 1.000041933.

This document is not complete without the associated Corner Perpetuation plat and report of survey for Section 5 or 6 Township 10 North Range 1 West by Michael E. Sheppard of the Monroe County Surveyor's Office.

CERTIFICATIONS:



Michael E. Sheppard

Date: 1/20/2026

Michael E. Sheppard

State of Indiana

Professional Surveyor

No. 20100021



Trohn Enright-Randolph

Date: 1/20/2026

Trohn Enright-Randolph

Monroe County Surveyor



Dennababida

Accepted by the Monroe County
Surveyor Review Board on

1/20/2026



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 4 of 4

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 5

Township: 10 North


Range: 1 West

Corner ID: Wash E-03

Monument Description & Remarks: 1" Rebar with cap, "INDEPT RES #0021". Surveyor Sign 1.5ft above ground at pt. B

References On File: Robert C. Vollmer survey, Morgan - Monroe State Forest
Martinville, IN (1988), on file in Surveyor Office

RECOVERY TIE DRAWING
Field Book 42 Page No. 73

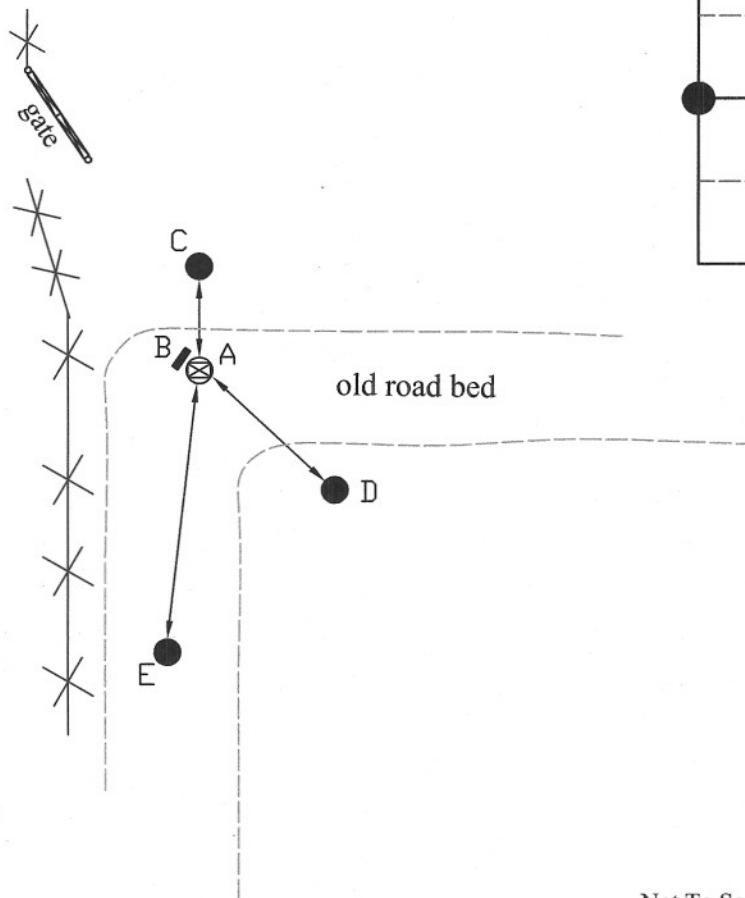

- A - 1" Rebar with cap
- B - N 47° W 0.81' to Survey Sign on 1/2" Rebar post
- C - N 12° E 16.08' to 6" MAG Hub
- D - S 36° E 53.57' to MAG nail in 30" Bifurcated Pignut Hickery
- E - S 06° W 63.14' to Limestone post

Not To Scale
Compass Bearing Magnetic North

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11, of the Indiana Code, and the above data is given under my hand and seal this 13th day of July, 2009.

Kevin Enright



Administered by the Monroe County Surveyor Review Board

Date: 10/20/2009

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 6

Township: 10 North



Range: 1 West

Corner ID: Wash E-03

Monument Description & Remarks: Limestone, height; 1.10ft, length; 0.35ft, width; 0.35ft, found. Survey Sign 5ft above ground at Pt. (B).

References On File:

RECOVERY TIE DRAWING
Field Book 32 Page No. 40

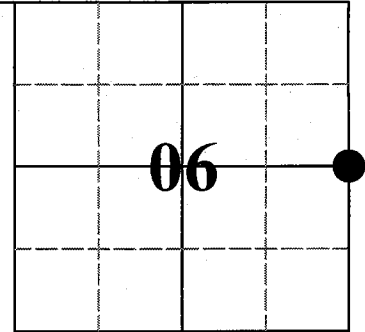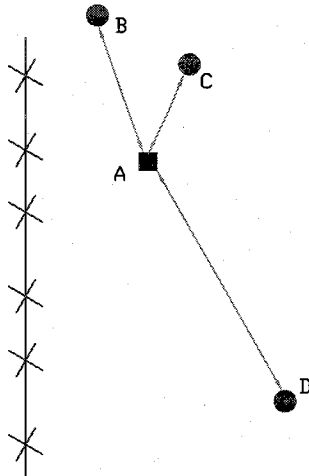

A - Limestone.

B - N 13° W 18.94' to MAG nail
in Survey Sign on 14" Tulip Poplar.

C - N 15° E 14.65' to MAG nail
in 20" Tulip Poplar.


D - S 15° E 47.21' to MAG nail
in 24" Sugar Maple.



Not To Scale
Compass Bearing Magnetic North

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36 of the Indiana Code; and the above data is given under my hand and seal this 10th day of May, 2000.

Kevin P. Enright

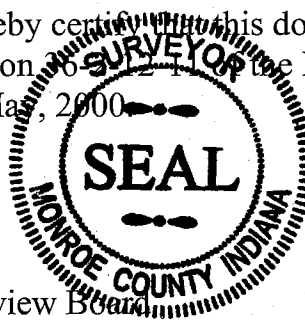

Administered by the Monroe County Surveyor Review Board

Date: See SRB minutes 7-18-06 KE.

Corner I.D. # ~~1~~-3


E-3
corrected
3/8/05

MONUMENT RECORD

STATE OF INDIANA ~ COUNTY OF MONROE

Section 5, Township 10 North, Range 1 West,

Monument Description & Remarks: 0.3' x 0.3' Cut Limestone with "+" on top 1.0' above grade.

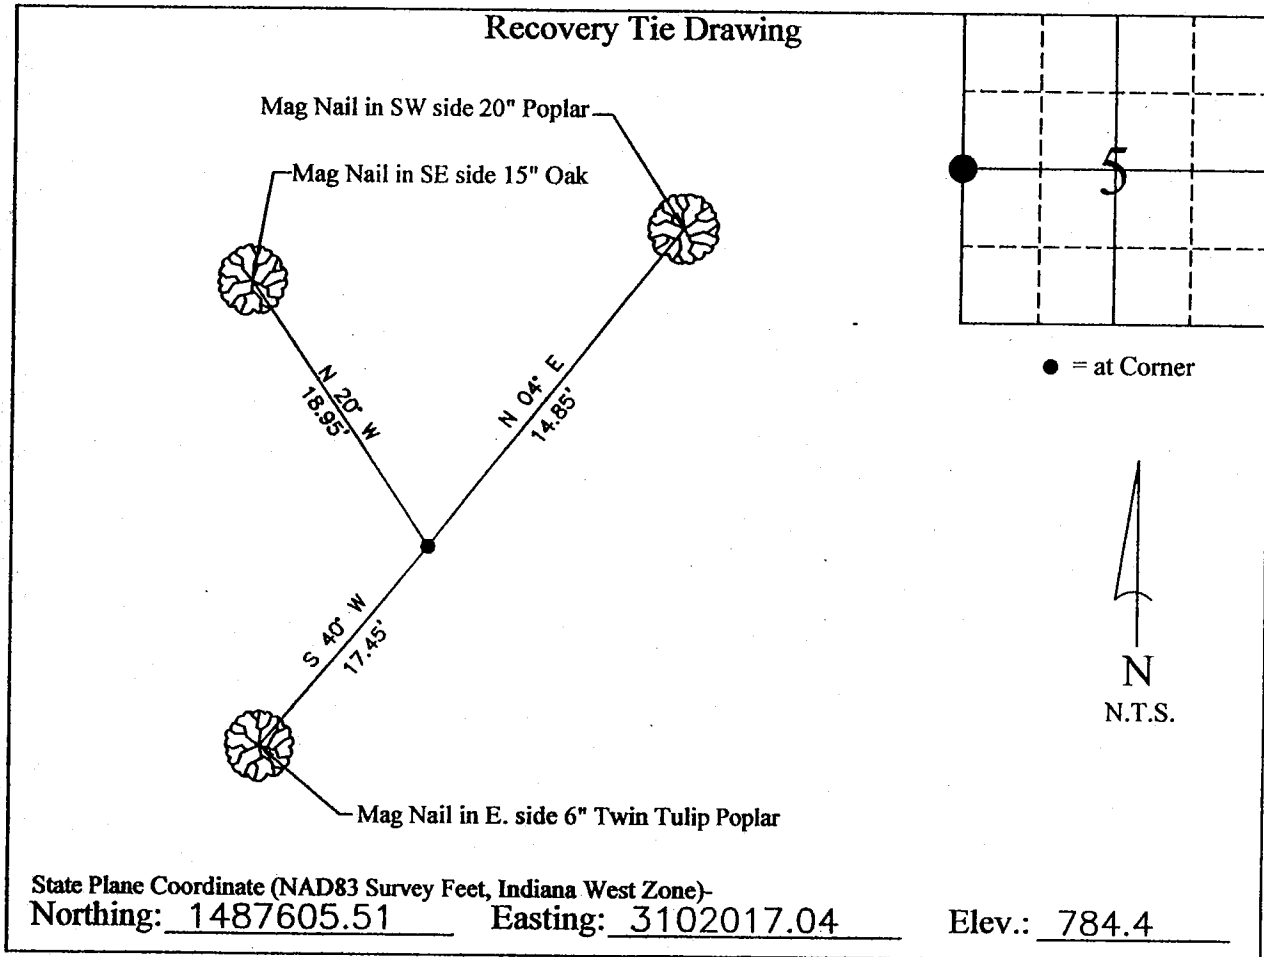

I, Ben E. Bledsoe, Registered Land Surveyor, here by certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; this 6th day of January, 2005 A.D.

Ben E. Bledsoe

Indiana Registered Land Surveyor No. S0559

